

Site Accessibility Evaluation

Americans with Disabilities Act Title II (Public Services: State and Local Government)



Fire Station 15

**4770 Scarlet Dr
Briargate, CO 80920**

Accessibility Evaluation

***Inspection Date: 12/15/2016
Inspector: Michael Killebrew,
Anna Kangas***

Prepared By



OLYMPIC CITY USA

(719) 385 - 5175

<https://coloradosprings.gov/>

TO: CSFD

FROM: Robert L. Hernandez

DATE: May 31, 2019

SUBJECT: Fire Station 15 Self-Evaluation

1. On December 15, 2016, Mr. Michael Killebrew, Title II ADA/Section 504 Coordinator performed a Title II - Americans with Disabilities Act (ADA), Self-Evaluation. This evaluation was in accordance with 1991/2010 ADA Standards for Accessible Design. The facility was re-evaluated on April 25, 2019 with the assistance of Anna Kangas, Architect/Title II ADA/Section 504 Coordinator.

2. Priorities for accessibility are assigned in accordance with the ADA Checklist for Existing Facilities. The checklist follows the four priorities listed in the Department of Justice ADA Title III regulations. These priorities are equally applicable to state and local government facilities:

Priority 1 - Accessible approach and entrance

Priority 2 - Access to goods and services

Priority 3 - Access to public toilet rooms

Priority 4 - Access to other items such as water fountains and public telephones

3. Corrective actions to findings were/will be submitted for corrective action through the city maintenance work request system and Transition Plan. Note: Recommended corrections in some cases where needed will be modified when appropriate. Corrections are developed in consideration of the "Program Access" provisions of Title II, where applicable.

4. A copy of this report will be maintained in the Office of Accessibility.

City of Colorado Springs Title II ADA/Section 504 – Manager
30 S. Nevada Ave, Suite 301
Colorado Springs, CO 80903
robert.hernandez@coloradosprings.gov

Atch 1. City of Colorado Springs, ADA Self-Evaluation Report

Sincerely,



Robert Hernandez

Exterior - Parking

Lat: 38.9523200000, Long: -104.7375558000

Finding: 1

There are no accessible parking stalls.

Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance.

2010 ADAS Section 208.2

Parking spaces complying with 502 shall be provided in accordance with Table 208.2 except as required by 208.2.1, 208.2.2, and 208.2.3. Where more than one parking facility is provided on a site, the number of accessible spaces provided on the site shall be calculated according to the number of spaces required for each parking facility.

Citation:

2010 ADAS Section: 208.2

As Built:

There are 9 parking spaces but none of them are marked as accessible.

Recommendation:

Either create accessible parking or post "Employee Parking Only".

Barrier Priority:

1 (High): Should be completed immediately. (Includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

CSFD



Total Number of Parking Spaces Provided in Parking Facility	Minimum Number of Required Accessible Parking Spaces
1 to 25	1
26 to 50	2
51 to 75	3
76 to 100	4
101 to 150	5
151 to 200	6
201 to 300	7
301 to 400	8
401 to 500	9
501 to 1000	2 percent of total
1001 and over	20, plus 1 for each 100, or fraction thereof, over 1000

Finding #1 Additional Finding Photos



Finding 184845 Additional Photo



Finding 184845 Additional Photo

Exterior - Accessible Routes

Lat: 38.9523200000, Long: -104.7375558000

Finding: 2

The walkway contains abrupt vertical edges and/or variations over a 1/4 inch.

1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less.

Changes in level greater than 1/2 inch must be by way of a ramp.

2010 ADAS Section 303.3

Changes in level between 1/4 inch (6.4 mm) high minimum and 1/2 inch (13 mm) high maximum shall be beveled with a slope not steeper than 1:2.

2010 ADAS Section 303.2

Changes in level of 1/4 inch (6.4 mm) high maximum shall be permitted to be vertical.

Citation:

2010 ADAS Section: 303.3, 303.2

As Built:

In the sidewalk to the main entrance, there is a metal plate covering a drainage area. There is a 1" gap between the sidewalk and metal plate.

Recommendation:

Fill the gap and fix the plate in place.


Barrier Priority:

1 (High): Should be completed immediately. (Includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

CSFD

Finding #2 Continued

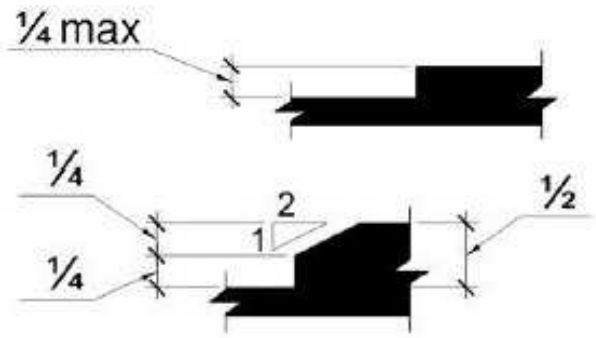

Finding #2 Additional Finding Photos



Finding 184848 Additional Photo

Exterior - Accessible Routes

Lat: 38.9523200000, Long: -104.7375558000

Finding: 3

The accessible path of travel contains cross slopes greater than 2%.

Surface cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp.

2010 ADAS Section 403.3

The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.

Citation:

2010 ADAS Section: 403.3

As Built:

There is 3% cross slope in the section of sidewalk at the driveway.

Recommendation:


Remove and replace the sidewalk to achieve maximum 2% cross slope.

Barrier Priority:

1 (High): Should be completed immediately. (Includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

CSFD

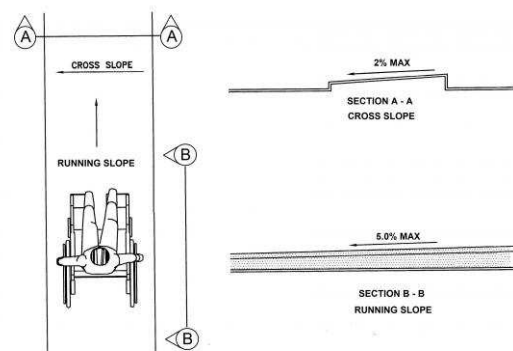

Exterior - Entrance

Lat: 38.9523200000, Long: -104.7375558000

Finding: 4

The door bell is positioned too high for either a side or front approach.

Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground.

Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.

2010 ADAS Section 308.1
Reach ranges shall comply with 308.

Citation:

2010 ADAS Section: 308.1

As Built:

The door bell is mounted at 50" and is obstructed by the mailbox.

Recommendation:


Lower the doorbell to 48" and move the mailbox so the door bell can be seen and accessed.

Barrier Priority:

1 (High): Should be completed immediately. (Includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

CSFD

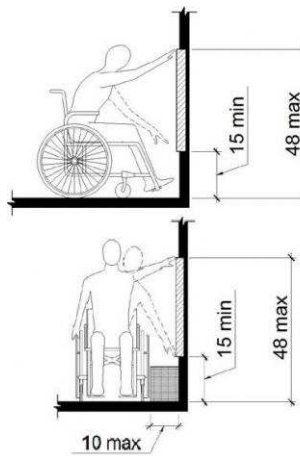

Exterior - Entrance

Lat: 38.9523200000, Long: -104.7375558000

Finding: 5

The door bell is not positioned correctly for either a side or front approach.

Where a clear floor or ground space allows a parallel or front approach to a switch or receptacle and the side reach is unobstructed, the high side reach shall be 48 inches maximum above the finish floor or ground and the low side reach shall be 15 inches minimum above the finish floor or ground.

2010 ADAS Section 308.2.1

Where a forward reach is unobstructed, the high forward reach shall be 48 inches (1220 mm) maximum and the low forward reach shall be 15 inches (380 mm) minimum above the finish floor or ground.

Citation:

2010 ADAS Section: 308.2.1

As Built:

The door bell at the rear entrance is mounted at 49-1/2".

Recommendation:


Lower the door bell to 48" maximum.

Barrier Priority:

1 (High): Should be completed immediately. (Includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

CSFD

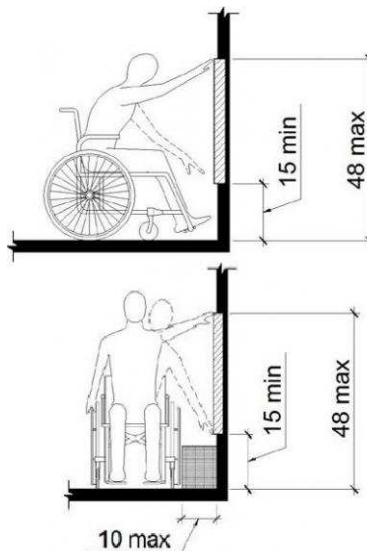

Interior - Restrooms

Lat: 38.9523200000, Long: -104.7375558000

Finding: 6

The restrooms have multiple issues, but are not intended for public use.

The owner or owners representative indicated that no public restrooms were available, however there was a non compliant restroom labeled as accessible and available to the public. If the restroom is desired to be an employee only restroom, it is recommended that the door be locked, the signs be removed and replaced with a new sign that that sates "employees only" or "private area". Any future improvements may be required under Title I of the ADA for work place reasonable accommodations.

Bathing and toilet facilities that serve buildings, facilities or portions of buildings or facilities that are required by these standards to be accessible to persons with disabilities, shall be on an accessible route.

2010 ADAS Section 213.1

Where toilet facilities and bathing facilities are provided, they shall comply with 213. Where toilet facilities and bathing facilities are provided in facilities permitted by 206.2.3 Exceptions 1 and 2 not to connect stories by an accessible route, toilet facilities and bathing facilities shall be provided on a story connected by an accessible route to an accessible entrance.

Citation:

2010 ADAS Section: 213.1

As Built:

The restrooms are not accessible.

Recommendation:

Install signage indicating the restrooms are not for public use.

Barrier Priority:

3 (Moderate): Should be completed as soon as possible, but there may be other items that will provide greater access to persons with disabilities. (Includes findings that have a high financial impact on the entity in relationship to the degree of access provided)

Department:

CSFD

Finding #6 Continued



Finding #6 Additional Finding Photos



Finding 184850 Additional Photo



Finding 184850 Additional Photo



Finding 184850 Additional Photo