

Site Accessibility Evaluation

Americans with Disabilities Act Title II (Public Services: State and Local Government)



Memorial Park

The National Fallen

Firefighters Memorial

**1605 E Pikes Peak Ave
Colorado Springs, CO
80909**

**Accessibility Evaluation
Inspection Date: 01/14/2020
Inspector: Michael Killebrew
and Anna Kangas**

Prepared By



**COLORADO
SPRINGS**
OLYMPIC CITY USA
(719) 385 - 5175
<https://coloradosprings.gov/>

TO: Parks, Recreation and Cultural Services

FROM: Robert L. Hernandez

DATE: June 12, 2020

SUBJECT: Memorial Park International Firefighters Memorial Self-Evaluation

1. On August 11, 2015, Mr. Michael Killebrew, Title II ADA/Section 504 Coordinator performed a Title II - Americans with Disabilities Act (ADA), Self-Evaluation. This evaluation was in accordance with 1991/2010 ADA Standards for Accessible Design. The facility was re-evaluated on January 14, 2020 with the assistance of Anna Kangas, Architect/Title II ADA/Section 504 Coordinator

2. Priorities for accessibility are assigned in accordance with the ADA Checklist for Existing Facilities. The checklist follows the four priorities listed in the Department of Justice ADA Title III regulations. These priorities are equally applicable to state and local government facilities:

Priority 1 - Accessible approach and entrance

Priority 2 - Access to goods and services

Priority 3 - Access to public toilet rooms

Priority 4 - Access to other items such as water fountains and public telephones

3. Corrective actions to findings were/will be submitted for corrective action through the city maintenance work request system and Transition Plan. Note: Recommended corrections in some cases where needed will be modified when appropriate. Corrections are developed in consideration of the "Program Access" provisions of Title II, where applicable.

4. A copy of this report will be maintained in the Office of Accessibility.

City of Colorado Springs Title II ADA/Section 504 – Manager

30 S. Nevada Ave, Suite 301

Colorado Springs, CO 80903

robert.hernandez@coloradosprings.gov

Atch 1. City of Colorado Springs, ADA Self-Evaluation Report

Sincerely,



Robert Hernandez

Parking

Lat: 38.8328776000, Long: -104.7976163000

Finding: 1

The cross slope (short dimension) of the access aisle exceeds 2%.

2010 ADAS Section 502.4

Parking spaces and access aisles serving them shall comply with 302. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted.

Citation:

2010 ADAS Section: 502.4

As Built:

The cross slope in the access aisle on the left is up to 4%.

Recommendation:

Remove and replace the asphalt to provide maximum 2% cross slope.

Barrier Priority:


1 (High): Should be completed immediately. (Includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

Parks & Recreation



Image of access aisle with excessive cross slope

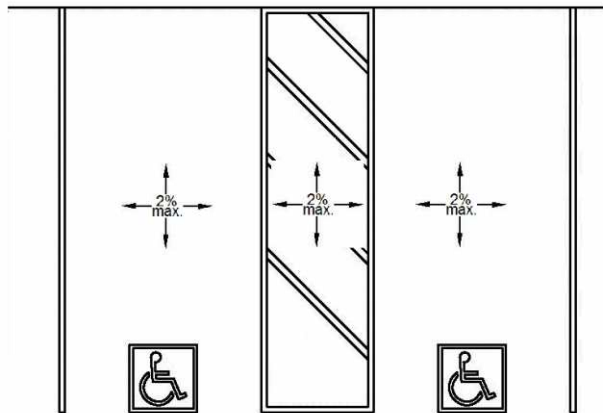

Parking

Lat: 38.8328776000, Long: -104.7976163000

Finding: 2

The cross slope (short dimension) of the access aisle exceeds 2%.

2010 ADAS Section 502.4

Parking spaces and access aisles serving them shall comply with 302. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted.

Citation:

2010 ADAS Section: 502.4

As Built:

The cross slope of the access aisle on the right is up to 3%.

Recommendation:

Remove and replace asphalt to provide maximum 2% cross slope.

Barrier Priority:


1 (High): Should be completed immediately. (Includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

Parks & Recreation



Image of access aisle with excessive cross slope

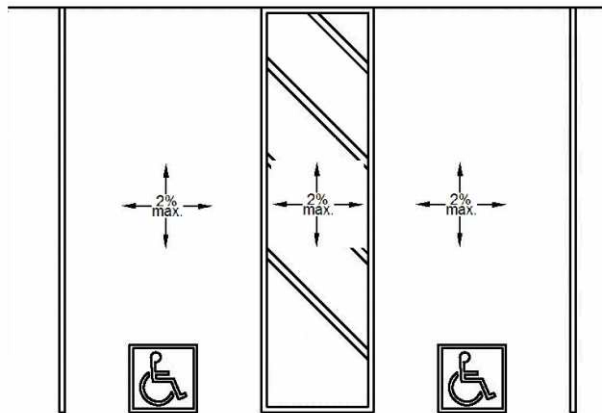

Parking

Lat: 38.8328776000, Long: -104.7976163000

Finding: 3

The required parking signage is missing.

Parking space identification signs shall include the International Symbol of Accessibility (ISA). Signs identifying van parking spaces shall contain the designation "van accessible." All signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.

2010 ADAS Section 502.6

Parking space identification signs shall include the International Symbol of Accessibility complying with 703.7.2.1. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches (1525 mm) minimum above the finish floor or ground surface measured to the bottom of the sign.

Citation:

2010 ADAS Section: 502.6

As Built:

There is not post-mounted accessible parking signage at either parking space.

Recommendation:

Install accessible parking signage. Designate one of the spaces as van accessible.

Barrier Priority:

1 (High): Should be completed immediately. (Includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

Parks & Recreation

Finding #3 Continued



Image of accessible parking without signage

